

Eco Tech Laboratory Ltd.
 10041 Dallas Drive
 Kamloops, BC
 V2C 6T4 Canada
 Tel + 250 573 5700
 Fax + 250 573 4557
 Toll Free + 1 877 573 5755
 www.stewartgroupglobal.com



StewartGroup
 Geochemical & Assay

ANALYTICAL RESULTS - # E11-3171

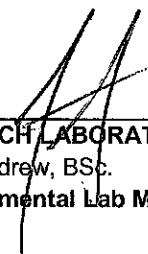
Nicola Lakeshore Water Utility Co.
 105-1121 McFarlane Way
 Merritt, BC V1K 1B9

21-Sep-11

SAMPLE IDENTIFICATION: 1 Water Sample Received: 14-Sep-11
 Sample Dated: 14-Sep-11
 Labelled: Arsenic Plant

PARAMETERS	Total Metals	Dissolved Metals	CDWG
Aluminum	0.003	0.002	0.1
Antimony	<0.001	<0.001	0.006
Arsenic	0.008	0.008	0.010
Barium	0.02	0.02	1
Beryllium	<0.001	<0.001	-
Bismuth	<0.001	<0.001	-
Boron	0.035	0.027	5
Cadmium	<0.001	<0.001	0.005
Calcium	31.58	31.11	-
Chromium	<0.001	<0.001	0.05
Cobalt	<0.001	<0.001	-
Copper	0.01	0.009	1
Iron	0.017	<0.005	0.3
Lead	0.005	0.003	0.01
Magnesium	14.79	14.55	-
Manganese	0.082	0.08	0.05
Molybdenum	0.009	0.008	-
Nickel	<0.001	<0.001	-
Potassium	5.71	5.63	-
Selenium	<0.001	<0.001	0.01
Silicon	13.12	12.84	-
Silver	<0.005	<0.005	-
Sodium	42.58	42	200
Tin	<0.01	<0.01	-
Titanium	<0.007	<0.007	-
Uranium	<0.001	<0.001	0.02
Vanadium	<0.001	<0.001	-
Yttrium	<0.001	<0.001	-
Zinc	0.063	0.061	5
Phosphorus	<0.08	<0.08	-

NOTE: Results expressed in mg/L unless otherwise indicated.
 CDWG = Canadian Drinking Water Guidelines
 (<) = Less Than


 ECO TECH LABORATORY LTD.
 John Andrew, BSc.
 Environmental Lab Manager

JA/sa
 Fax: 250-378-4106